

(1) Number of pages 8

(2) Date of repair 15-4-42

(3) Initials of the Referencer

MADRAS RECORD OFFICE.

Government of Madras.

Public Works DEPARTMENT.

G.O. No.	<u>85</u>	Press
<u>167-168</u>		<u>Mis.</u>
Dated	<u>30-1-</u>	<u>1862.</u>

Not to be folded or roughly handled

12

*Proceedings of the Madras Government, Public Works Department,
30th January 1862.*


No. 167. Read the following Endorsement of Lieutenant-Colonel J. OUCHTERLONY, for Deputy Chief Engineer Southern Circle, dated Chepauk, 22nd January 1862, No. 9,669.

Read the following letter from Captain R. F. OAKES, District Engineer, to the Deputy Chief Engineer, Southern Circle, dated Lower Anicut, 15th January 1862, No. 265:—

SIR,

1. In continuation of my reports on the Lower Anicut on the 30th November and 12th December, I have the honor to inform you that after the leaks referred to in letter No. 226 had been stopped or nearly so, other leaks appeared to the northward or in front of the 19th arch from the north end; similar means were adopted to stop those leaks as had already proved successful.

26th December.

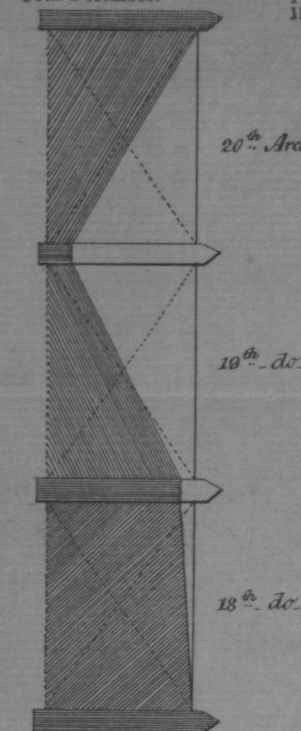


2. A small embankment was run across the bed of the river in front of the injured portion of the Bridge and Anicut to prevent further scour and to admit of some means being adopted to shore up and secure the arches on either side of those injured. The Bridge was thus deprived of the support afforded by the buoyancy of the water and on the morning of the 5th instant, a large portion of the pier common to the 19th and 20th arches sunk westward, carrying away with it the unshaded portions of the 19th and 20th arches and leaving only 3' 9" of the arch on the 19th pier standing. In falling the 19th arch dragged with it the cut water and about 2' of the 18th pier on the west side and about 2' of the 18th arch with the spandril and parapet. The 18th pier appears however to be entirely sound and the portion carried away was removed owing to the adhesion of the brick work and the fall of the parapet and face wall above it.

3. The piers which support the 21st or sluice arch do not appear to have settled more than they had done on the 30th November, and the foundation of the extremities of the piers would appear to be sound, the sinking or settling having taken place under the centre of the piers only.

4. The Anicut has, as might have been expected, been injured by the settlement of the piers, but the injury sustained is very trifling.

5. On the 10th the river rose, owing to local rains, to a height of about 4½' and breached the front embankment before the injured portion of the Anicut. This is now being restored to enable Colonel Birdwood to examine the work, and an estimate will be prepared and submitted as soon as the full extent of the injury has been ascertained. In the meantime preparations are being made for materials for the re-construction of the Bridge and injured portions of the Dam.

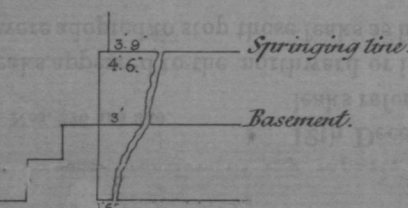

*Proceedings of the Madras Government, Public Works Department,
30th January 1862.*

* Vide Endorsement, Nos. 8,343 and
8,715, dated 13th and 23rd Decem-
ber 1861.

Submitted for the further* early information of Govern-
ment. Colonel Birdwood, the Deputy Chief Engineer Southern
Circle, is expected back from his visit of inspection on an early
date, when a full report on the actual condition of the Anicut will be submitted to Government.

(Signed) J. OUCHTERLONY, Lieut.-Colonel,
For Deputy Chief Engineer, Southern Circle.

No. 168.

ORDER THEREON, 30th January 1862, No. 85.

The Government will await the report of the Deputy Chief Engineer, Southern Circle, on
the condition of the Anicut.

(Signed) W. H. HORSLEY, Lieut.-Colonel,
Chief Engr. and Secy. to Govt., D.P.W.

No 265 of 1861/62

39

Southern Circle

District Engineer Office
Lower Minicutt 15 June 1862

From

Captain R. F. Baker

District Engineer

The Deputy Chief Engineer
D.P.W.

Public Sir

22268240



26 Dec

In continuation of my re-
ports on the Lower Minicutt on the
30th November and 12th December I
have the honor to inform you that after
the leaks referred to in Letter No. 2
had been stopped in nearly all other
leaks appeared to the South end
in front of the 14th arch from the
South end; similar means were
adopted to stop those leaks as had
already proved successful
2 A small embankment was
run across the bed of the river in
front of the injured portion of the
Bridge and Minicutt to prevent
further scour and to admit of some
means being adopted to shore up
and secure the arches on either side

of those injured. The Bridge was thus deprived of the support afforded by the buoyancy of the water and on the morning of the 5th instant a large portion of the Pier common to the 19th and 20th arches with 12 we stward, carrying away with it the unshaded portions of the 19th and 20th arches and leaving only 3' 9" of the arch on the 19th Pier standing. In falling the 19th arch dragged with it the cut water end about 2' of the 18th Pier on the west side and about 2' of the 18th Arch with the parapet and Parapet. The 18th Pier appears however to be entirely sound and the portion carried away was removed owing to the addition of the Brick work and the fall of the Parapet and face wall above it.

3 The Piers which support the 21st or Shuck arch do not appear to have settled more than they had done on the 30th December and the foundation of the extremities of the Piers seems to appear to be sound, the sinking or settling having taken place under the center of the Piers only.

The

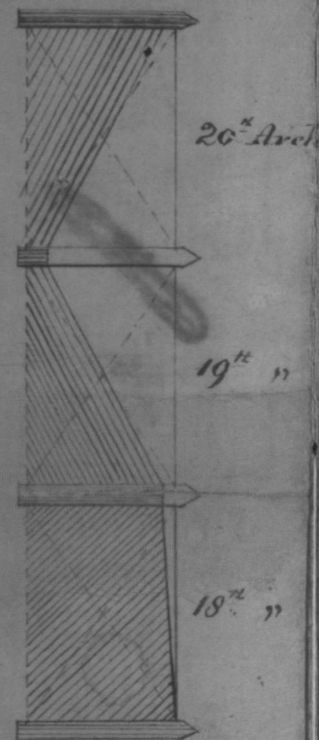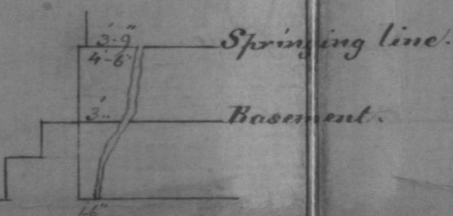

4 The Ammiratt has as might have been expected been injured by the settlement of the Piers, but the injury sustained is very trifling.

5 On the 10th the River rose owing to local rains to a height of about 4 1/2' and breached the front embankment before the injured portion of the Ammiratt. This is now being restored to enable Colonel Birdwood to examine the work and an Estimate will be prepared and submitted as soon as the full extent of the injury has been ascertained. The necessary preparations are being made for materials for the reconstruction of the Bridge and injured portion of the Dam.

I have the honor to be
Sir

Your most obed^t servant

H. F. Baker Captain
District Engineer

N^o 1/4

* Vide endorsement
N^o 8343 and 8415
dated 13th and 23rd
December 1861.

Submitted for the further early information
of Government. Colonel Birdwood, the Deputy

From

The North West Regt

of Engineers

The Deputy Chief Engr

C. E.

Receives

21st Jan 1862

No 215

Refraining from

inquiries to the

Engineers Bureau

and leave.

With an Order

19669.

21/1/62

No. 9669

Deputy Chief Engineer, Northern Circle,
is expected back from his visit of inspection
on an early date, when a full report
on the actual condition of the Amunts
will be submitted to Government.

Respectfully Sir^t Colonel

Genl Office P^r
Chief Engr
22 January 1862

for Deputy Chief Engineer S. C.

S^d

Sir^t Colonel W. H. Horeley
Chief Engr & Secy to Genl W. H. D.
Fort Saint George

Jan 31st Dec 1861 No.
462-464

Wm 13 Jan
to the Secy Chief Engr of Circle Major 4

of the Deputy Chief Engineer of Circle on the
condition of the work.
Fort St George
30th Jan 1862

1929.88
No 164/68

Public Works 1862 Dept
No: of Govt for January
From No 150.

Colonel B Birdwood
Depy Chief Engr
To Lieut Colonel W B Moreley
Chief Engr & Secy to Govt
Fort Saint George

Dated 22nd
Recd 23rd January 1862

35
20-1-62
Depy No 9669

Submits for
information a letter
from the District Engineer
of Tanjore reporting further
injuries to the Lower
Anicut and Dam.

No 85-30 January
of the an order

Fort Saint George