

(1) Number of pages_____

(2) Date of repair_____

(3) Initials of the Referencer_____

MADRAS RECORD OFFICE

Government of Madras

Public Works

DEPARTMENT

G.O. No.	1503	Press
B.P. No.		Mis.---
Dated	31-5-195	6875-

Not to be folded or roughly handled

*Proceedings of the Madras Government, Public Works Department,
31st May 1875.*

Read the following papers :—

No. 580. From Lieutenant-Colonel C. S. HEARN, Inspector-General of Police, to Colonel G. W. WALKER, R.E., Secretary to Government, Public Works Department, dated Ootacamund, 6th April 1875, No. 1,761.

I HAVE the honor to forward a letter from the Superintendent of Police, Madura, submitting for sanction an estimate, Rupees 100, of repairs required to the station-house at Tiroovadany in that district.

2. This station-house was completed by the Public Works Department in 1873 at a cost of Rupees 1,194, and from the account given by the Superintendent of Police it would seem already to need more extensive repairs than the present estimate will properly meet.

From Captain F. KILGOUR, Superintendent of Police, Madura, to Lieutenant-Colonel C. S. HEARN, Inspector-General of Police, dated Madura, 27th March 1873, No. 150, (through Deputy Inspector-General.)

In forwarding for your sanction an estimate, amounting to Rupees 100, on account of repairs required to the Tiroovadany Police Station together with letter No. 5,221, dated 20th March 1875, I have the honor to offer the following remarks.

2. This station was built in 1872-73 by the Public Works Department at a cost of Rs. 1,194.

3. Soon after its completion it was found to leak, and cracks appeared in the walls under one beam. The District Engineer was written to; above quoted letter and estimate has been received in reply.

4. On the 23rd February last I inspected this station; the District Magistrate was also there; in the station visiting book he remarks as follows :—"The station has been lately completed at a heavy outlay; the beams supporting the roof are much bent. There are several cracks in the walls, and the whole construction seems to be of an inferior description."

5. There cannot be any doubt that the roof of the building is badly constructed, the bressummers which supports it being either too light or of bad wood, have bent, consequently the roof has curved.

6. I submit that the provision made to rectify this defect in the estimate of the District Engineer is altogether inadequate; the District Engineer proposes to prop up the faulty roof by means of pillars; this seems to me to be an insufficient and clumsy arrangement; it may prevent the building from falling down, but the badly constructed roof will remain intact.

No. 581. From Lieutenant-Colonel J. F. FISCHER, R.E., District Engineer, Madura, to Colonel G. W. WALKER, R.E., Secretary to Government, Public Works Department, dated Madura, 27th April 1875, No. 297.

With reference to your memorandum, No. 410, under date the 16th instant, I

1 Plan.

1 Copy of letter.

have the honor to forward the accompanying copy of a report from the Sub-Engineer, Madura Range, No. 50, of the 23rd idem,

regarding the Police Station-house at Tiroovadany, and to state that I find the beams allowed in this district for flat roofs to be throughout of insufficient scantling for the common wood which is used in an unseasoned state.

Proceedings of the Madras Government, Public Works Department,
31st May 1875.

From N. MOONEAPAH PILLAY, Sub-Engineer, Madura Range, to Lieutenant-Colonel J. F. FISCHER, R.E., District Engineer, Madura, dated Madura, 23rd April 1875, No. 50.

With reference to your endorsement, No. 258, of 21st April 1875, I have the honor to report that the station-house building at Tiroovadany was built on a design per standard plan and estimate wherein the bressummer across the hall of 12 feet long is allowed 9 inches height by 6 inches depth only, which has pleyed owing to pressure of weight above it and caused cracks over the terrace.

2. To remedy the complaint two pillars are proposed to be built, as shown in the plan, with a view of reducing the bearing, then scrape off the top surface of the terrace where the leakages are found and meet them with asphalte, &c., as provided in the estimate submitted for sanction.

3. The trellis works in the dwarf walls in the verandah and the floor ventilator in the lock-up without shutters are complained of by the Police occupying it as harbouring various insects and snakes, and therefore provisions are made to prevent the complaints by allowing solid parapets and closing the ventilators.

4. The matter in question is not attributable exactly to constructive defects, but partly to the design and partly to nature of work, as fresh terrace works are likely to shrink and cause cracks during the course of ensuing season.

5. The work has been carried out departmentally as ordered by the late Range Officer, and supervised by me when in charge of the sub-division.

No. 582.

ORDER THEREON, 31st May 1875, No. 1,503.

CIVIL WORKS, No. 38.

COLONEL FISCHER does not seem to recollect that it rests with him as District Engineer to mete out to the best of his

judgment the degree of blame and responsibility resting on his subordinates in a case of this kind, and to record at the same time his distinct professional opinion as to the sufficiency or otherwise of the remedies proposed.

2. It appears from the standard plan that the bearing of the bressummer which has failed should have been nine instead of twelve feet, and that the piers which it is now proposed to construct should have been built originally. Moreover, it does not seem to the Government to be necessary or inevitable that common and unseasoned wood should be used throughout the district, although Colonel Fischer accepts it as a fact. But even if it were so, if the standard estimate specified certain dimensions in timber of good quality, the constructor who necessarily uses inferior material is responsible for a due regard to that fact in apportioning his scantlings. A further and full report from the District Engineer will be awaited.

(True Extract.)

(Signed) J. O. HASTED, Major, R.E.,

Officiating Joint Secretary to Government.

To the District Engineer, Madura.
" Inspector General of Police.

Exd. S. T. Austin.

Spare Copies

No 150

Madura Police Office
27 March 1873.

From The Superintendent of Police
Madura

Through
D E G

To The Inspector General of Police
Madras

In forwarding for your sanction an estimate amounting to Rs 100 an account of repairs required to the Tiroovadany Police Station together with letter No 5221 dated 20 March 1875, I have the honor to offer the following remarks.

I This Station was built in 1872-73 by the Public Works Department during the official year at a cost of Rs 1194.

II Soon after its completion it was found to leak and cracks appeared in the walls under one beam. The District Engineer was written to at one of our letters and estimate has been received in reply.

III On the 23rd February last I inspected this Station. The District Magistrate was also there, in the Station meeting book, his remarks as follows: "The Station has been lately completed

at a heavy outlay, the beams sup-
-porting the roof are much bent.
There are several cracks in the walls
and the whole construction seems
to be of an inferior description."

V There cannot be any doubt
that the roof of the building is badly
constructed, the Brissummen which
supports it being either too light
or of bad wood, have bent,
consequently the roof has curved.

VI I submit that the provision
made to rectify this defect in the
estimate of the District Engineer
is altogether inadequate, the District
Engineer proposes to prop up the
faulty roof by means of pillars; this
seems to me to be an insufficient
and clumsy arrangement, it may
prevent the building from falling down
but the badly constructed roof will
remain intact.

I have the honor to be

Sir,

Your most obedt. Servant

W. J. G. S. Captain

Superintendent of Police

O. N. 2331/75
3/75

W. J. G. S.
1.2.75

No. 1767

Office of the Inspector General of Police
Cotacaimund 6 April 1875.

From The Inspector General
of Police

To The Secretary to Government
Public Works Department,
Fort Saint George.

Sir, I have the honor to forward a letter
from the Superintendent of Police Madurai
submitting for sanction an estimate of repairs
required to the Station House at Tiruvadany
in that District.

2. This station House was completed
by the Public Works Department in 1873 at
a cost of Rs. 1194 and from the account
given by the Superintendent of Police it
would seem already to need more extensive
repairs than the present estimate will
properly meet.

I have the honor to be
Your most obedt. Servant,

C. L. M. M.
Inspector General of Police.

Detailed Estimate to of 1875-76.
Madura District Zemindary Sub Div Seroonampah
Work - Repairing and Improving the Police Station
House at Seroonampah.

Description of work.	Measurements			Quantity
	Length	Breadth	Thickness	
Supporting wall under beams including Basement and Foundation	1 1/2	1 1/2	1 1/2	57 1/2
Blocking up Dwarf wall in Verandah	18	1	1 1/2	27
Do Floor Ventilator	3	1 1/2	1	4 1/2
Total sq ft of Brickwork and or including				81
<u>Repairing Terrace.</u>				
Record Room and Lock up	15 1/2	20	"	310
Verandah	30	5	"	150
Total Repairing Terrace with a layer of flat tiles and 3" concrete in channels				460
or Squirrels				460
<u>Asphalt.</u>				
Tramway close by Parapet wall	80	2	"	160
In Verandah	40	2	"	80
Total sq ft of Asphalt 1/2" thick or Spec				240
Wall plate stones	1 1/2	1 1/2	1/2	102

James Hindmarsh
 Sub overseer 1st grade.

20 2557 of 300000/72

P. N. 1875 24th Nov. 2331.
 The Secy to the
 Madras District
 Zemindary
 Seroonampah
 Madras
 21/10/75
 I have the honor to acknowledge the receipt of your letter of the 17th inst. in relation to the estimate of Rs 1000 for repairing the Police Station House at Seroonampah for 1875-76.
 I have the honor to inform you that the same has been forwarded to the District Engineer for his consideration.

No 50

Madras Range Office.
Mamam 23 April 175
Sept 26 20 20.

From

The Sub Engineer
Mamam Range

To

The District Engineer
Mamam

Sir,

With reference to your Indorsement
No 258 of 21st April 175 I have the honor to report
that the Station House Building at Timmaray
was built on a design per standard plan and
Estimate wherein the beammer across the
Hall of 12 feet long is allowed 9" x 6" only
which has pleyed owing to pressure of weight
above it and caused cracks over the terrace.

To remedy the Complaints two pillars
are proposed to be built as shown in the plan
with a view of reducing the bearing; then
scrape off the top surface of the terrace where
the leakage are found and meet them
with asphaltic &c as provided in the Estimate
Submitted for sanction.

The

Madras District
Resident
Mamam

Memorandum No 469

Separating and deepening
the Ocean at the station house
at Timmaray

Memorandum No 100

O.M. 233/175

Resident Engineer
Mamam

72
The trellis work in the dwarf
walls in the Verandah and the floor Venk.
lators in the Lock up without shutters are
complained of by the Police occupying it,
as harbouring various insects and snakes
and therefore provisions are made to pre-
vent the complaints by allowing solid
parapets closing the Venklatons.

The matter in question is not at-
tributable exactly to constructive defects
but partly to the Design and partly to
nature of work as fresh terrace works are
likely to shrink and cause cracks dur-
ing the course of raining season.

The work has been carried out
separately as ordered by the late
Range Officer and supervised by me
when in charge of the Lab Division.

Yrsg Hc.

Signed / Moincupah Pillay Sub-Engt
Madam Range

(True copy)

W. T. T. Chandra
District Engineer Madam

District Engineer's Office
to 297. Madras 27 April 1875
from

Genl Colonel J. Fischer
District Engineer Madras

Colonel W. Walker R.E.
Secretary to Government

With reference to your
Memorandum to 410 under
date the 16th instant I have
the honor to forward the
accompanying copy of a
report from the Sub Engineer
Madras Range to 50 of
the 23rd idem regarding the
Police Station House at
Trovadanay and to state
that I find the beams
allowed in this District for
flat roofs to be throughout

Enc 2
1 Plan
1 Copy of
letter

Enc 2 of J. A. A. letter
from the District
Engineer Madras
to the Secretary to
Govt of Madras
27 April 1875 to 297

D. 2833/55

Copy of letter

of insufficient searching for
the common wood which is
used in an unseasoned
state

I have the honor to be

Your Most Obedt servant

Wm. Lusk


District Engineer

1875
1876
1877
1878
1879
1880
1881
1882
1883
1884
1885
1886
1887
1888
1889
1890
1891
1892
1893
1894
1895
1896
1897
1898
1899
1900

1875
1876
1877
1878
1879
1880
1881
1882
1883
1884
1885
1886
1887
1888
1889
1890
1891
1892
1893
1894
1895
1896
1897
1898
1899
1900

1875
1876
1877
1878
1879
1880
1881
1882
1883
1884
1885
1886
1887
1888
1889
1890
1891
1892
1893
1894
1895
1896
1897
1898
1899
1900

10a

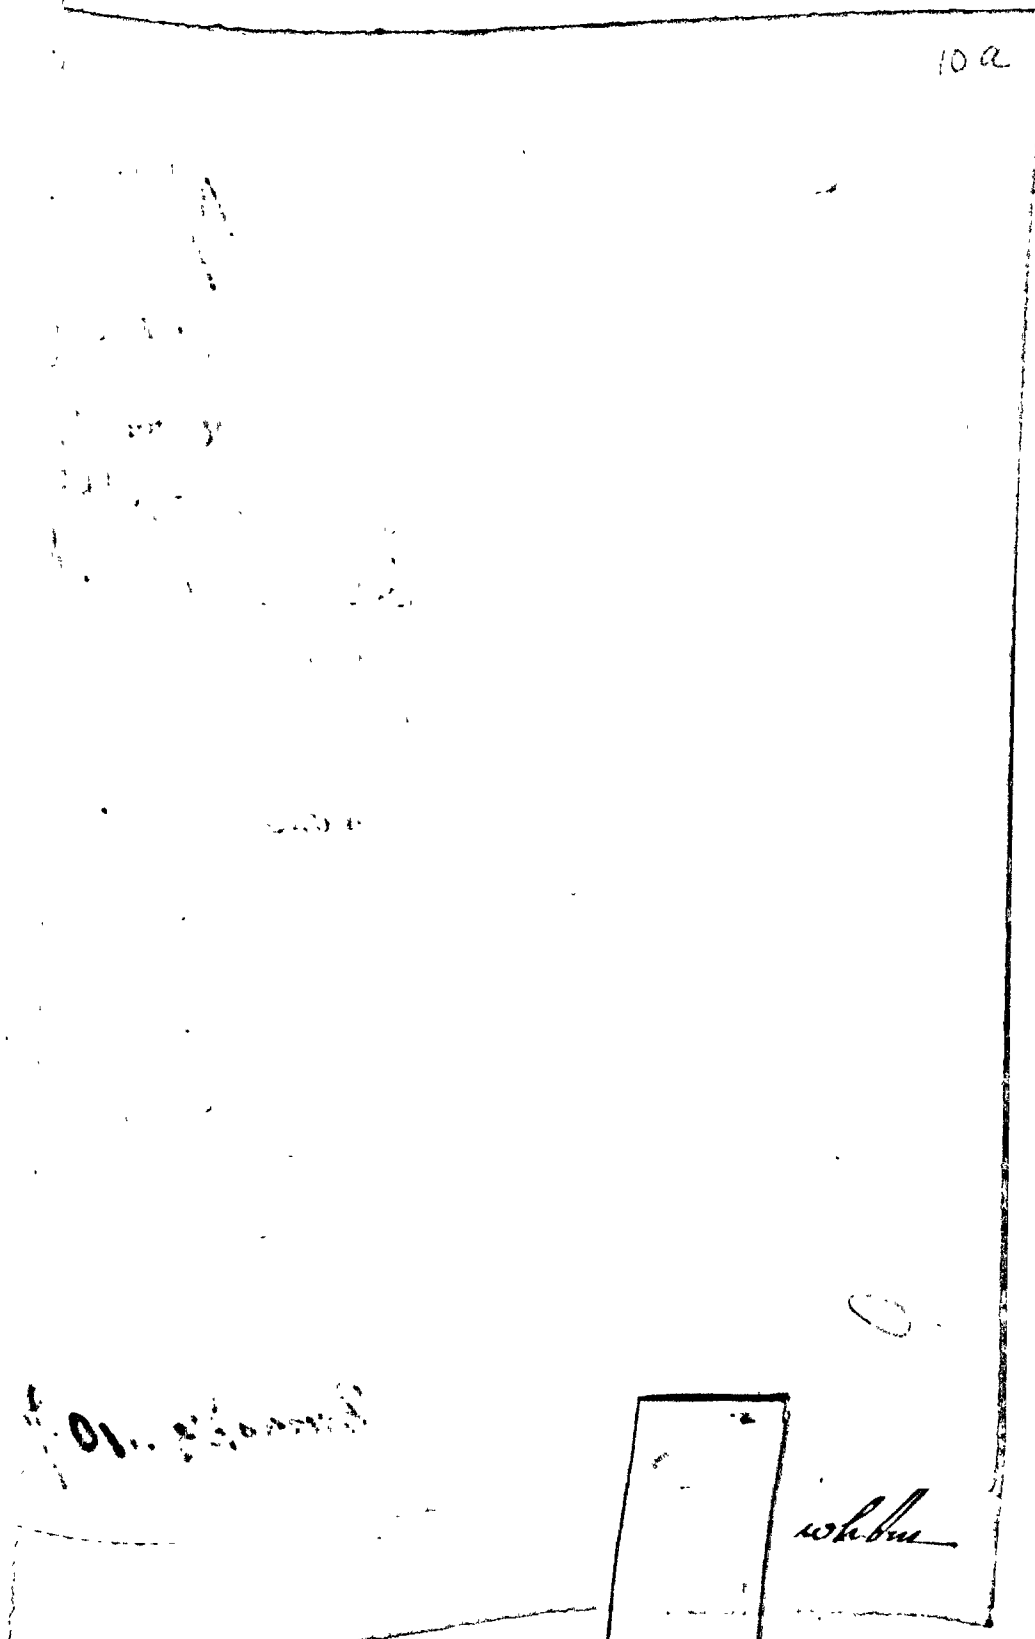

10. 2. 10. 10.

whbu

Mr. 1895 ~~del~~

from 22nd 2833.

S. A. Steel 4.

Ed. Dickel Engineer

Madison

To the Secretary of the Government

Date 27 April 75
Received 37th

Enc. 2

Forwarded for information copy of a letter from Madison (Camp Office) regarding of record. Also Madison (Camp) 20th 1895. 21.5.75.

Ms 581

Ms 19/5/75. Ms 20/5/75. H. Steel 4.5 miles.

1875 Dept

Encl No 1 to 3

In a letter from the Insp
Genl of Police dated
Ootacamund 6 April
1875 No 1761

From the Insp of Police
Madura

of 31 May 75 in No 580

Submits for sanction
estimate for repair
Tirovadanu Police stn

Mem No 410 of 16-4-75

From
the Insp

No 2331

No 410 16th April 75

Memorandum

Letter from the Inspector General of Police No 1761
dated 6th April 1875.

The Inspector General of Police has
forwarded an estimate of Rs 100 for repairing
the station house at Tirovadanu which
he mentions was completed by the Public
Works Department in 1873 at a cost of Rs 1194.

The undersigned is directed to
request the District Engineer Madura to
furnish a full report on the subject
of the condition of this building, with a
plan showing the proposed remedial
measures. It should be stated by
whom

when the construction was supervised
and what are the constructive defects.

By Order

Sig^d A. C. Scott Major R.E.
Under Secy to Govt.
C.N.D.

G.O. - 36 May 75 No 1503.

To The District Engineer
Madura

Public Works Dept.

Proceedings of the Madras Government
Under date the 1875

From the Inspector of Police (M.R. No 176 of 6 April 1875)
The Dist. Eng. Madura (H.E. No 297 of 27 April 1875)

G.O. No 1503 of 31st May 75

Colonel Fraser does not
seem to recollect that
it rests with him as
District Engineer to make
out the degree of blame
to be assigned - resting
on his Subordinates is a
case of this kind and
to recollect at the same time
his distinct professional
opinion as to the sufficiency
or other wise of the masonry
proposed.

It appears from the standard
plan that the bearing of the
Alpurnam which has failed
should have been nine instead
of twelve feet & that the pier
which it is now proposed
to construct should have
been built originally. However

does not seem to the fact
to be necessary ^{scientifically} that common
& unseasoned wood should
be used throughout the
District although Col
Traylor accepts it as a
fact. But even if it were
so - if the standard
estimate specified certain
dimensions in timber of good
quality, the Contractor who
~~was~~ supplying was in-
ferior material is responsible
for a due regard to that fact
in appraising his billings.

A further & full report
from the District Engineer
will be awaited.

Adm'd

30
M 588/57

To Dist Engr Henderson ✓
" Engr J. C. Oliver ✓

Sc Dispd - 14-6-75

2331
2833

Govt. of 1875 Madras.
PUBLIC WORKS.

To

The St. Major,
Madras

Dated

By

Recd.

Encl.

G. O. 31 May No. 503

Nos. 580 - 582

Police Station-house at
Perovadanai, Madras.

Passing orders on the letters
of the Inspector-General of
Police and the District
Engineer, on the estimate
of Rs. 100 for repairing
the ———.