

(1) Number of pages 119(2) Date of repair 12 9 37

(3) Initials of the Referencer _____

MADRAS RECORD OFFICE.

Government of Madras.

Public Works DEPARTMENT.

G.O. No. 66.	Press
139-140.	~~Mis.~~
Dated 9 — 1 —	1867.

Not to be folded or roughly handled

*Proceedings of the Madras Government, Public Works Department,
9th January 1867.*

No. 139. Read the following letter from the Acting Superintending Engineer, 1st Division, to the Secretary to Government, Public Works Department, dated Camp, Vizianagrum, 10th December 1866, No. 207 :—

1. Plan.
1. Estimate.

G. O. No. 2,539 of 31st August 1865.
Rupees 152.

1. I have the honor to enclose an estimate for repairs amounting to reconstruction of a part of the Court-house at Vizagapatam, the building used as such was formerly the Jail, a large terraced

house, with an upper story, on four sides surrounding an open quadrangle, and verandah on three sides.

2. The roof of one side of this upper story had some time since caused so much pressure on the walls, that they were clearly thrown out of the perpendicular; to remedy this on one side, buttresses were constructed at a cost of Rupees 152, sanctioned in G. O. No. 2,539 of 31st August 1865; the spreading of the roof has, however, continued, and several of the rafters have now no footing on the wall and are carried by the purlin only, the ends are eaten by white-ants in some degree also, so that there is no alternative but to take down and reconstruct the roof.

3. The verandahs, twelve feet wide, are very badly built, the roof, Bengal pattern, has very little slope; its rafters are not built into the wall at the upper end, but rest on a wooden bressummer supported by brackets from the wall, they have not even a notch to keep them in position, the consequence is that great pressure has been thrown on the pillars outside, which all show signs of weakness, the bressummers and brackets themselves too, have been in parts injured by white-ants.

4. I inspected the building at Captain Beatty's request, and have authorized his immediately removing some parts which are dangerous, and under which Suitors in the Court are likely to pass or stand in numbers.

5. Captain Beatty has warned the Judge also as to the risk from occupying the wing above mentioned, but I have no information as to the accommodation he can procure elsewhere. If he can vacate it, I shall request Captain Beatty to take down as much as he can from the roof to save the materials and to prevent its fall, but I trust that the Government can allot funds for the reconstruction of the building.

No. 849. ORDER THEREON, 9th January 1867, No. 66.

CIVIL WORKS, No. 33.

In G. O. No. 2,539, dated the 31st August 1865, sanction was accorded to an estimate of Rupees 152 for

the erection of buttresses to support the northern walls of the Civil Court-house at Vizagapatam. The Acting Superintending Engineer of the 1st Division now reports that, although that work was carried out, the roof of the building has continued to spread, and that it is absolutely necessary it should be taken down and reconstructed. Colonel Moberly further represents that the verandahs are in a dangerous state, and he submits an estimate amounting to Rupees 5,000 for such improvements as are actually required to place the building in a safe condition.

2. *bars & shutter Complete* } 4.8 . . 5. 96 . .
Carried Over 37129

**Proceedings of the Madras Government, Public Works Department,
9th January 1867.**

The Government approve of the estimate, and they resolve to place a sum of 2,000 Rupees at the Superintending Engineer's disposal from the Reserve under "Civil Buildings" to admit of the work being at once proceeded with. Should a further grant be necessary during the current official year, it will rest with Colonel Moberly to propose a diversion of funds from existing Reserve sanctions for works in the 1st Division.

(True Extract.)

(Signed) CHARLES A. ORR, Colonel, R. E.,
Secretary to Government.

To the Superintending Engineer, 1st Division.
" Controller of Public Works Accounts.
" Accountant General.
" Judicial Department.

Exd. S. T. Augustin.

DEPARTMENT

ABSTRACT ESTIMATE

TALUK *Vizagapatam.*

District *Vizagapatam.*

Work

Repairing the Court House at Vizagapatam.

Quantity.	Particulars of Work.	Rate.	Per Item.	Amount.	Total.
216 ⁵ / ₉	Cybs of Rubble masonry	1 10	Cybs	351 4 5	
283 ⁵ / ₉	Do of Brick in chunam	2 12	do	8 9 8	
29 ⁸ / ₉	Do of do in do (arch work)	4 9	do	136 5 10	
78 ² / ₃	Squares of plastering with one coat of chunam & white washing with 1 coat.	2 4	Sq.	172 1 3	
319 ¹ / ₁₁	Cybs of country wood wrought & put up	2 3	Cybs	678 7 11	
No 3	Country wood Sineses Complete	50	Each	150	
No 2	Do do do do	30	do	60	
37 ² / ₁₀	Squares of roofing with country wood rafters, rippers, nails, flat & pentiles & chunam borders & complete	21 12 10	Sq.	822 1 11	
24 ¹⁶ / ₂₈	Squares of Bengal mutton roof with do do 3 courses of flat tiles and plastering with 3 coats of chunam	25 6	do	625 12 10	
No 8	Pairs of Teak wood half pannelled & venetian doors with frames, iron fixtures complete	33 12	Each	236 4	
No 2	Do of do do venetian windows with do do & complete	16 8	do	33	
No 24	Do Teak wood ventilators with swinging shutters, iron fixtures & complete	8	do	192	
No 2	Iron barred windows with Teak wood shutters, frames & complete	42	do	84	
No 1	Teak wood shutter to door	8	do	8	
No 3	Teak wood shutters with iron fixtures complete	20 8	do	61 8	
No 2	Do do new windows with iron bars & shutters complete	4 8	do	96	
				37429	

Carried Over

6	Teak wood junctions between the pillars in front of Christadar's room.	10	Each	60	
12	1 Iron barred door with frames without shutters. Part to be fitted into the frames Complete	45	"	Each	45
1	Do do do do do do	48	"	do	48
2	Do do do do do do	41	"	do	82
1	Iron barred door opening with frames, iron fixtures & Complete	48	"	Each	48
1	Do do do do do do with do do	51	12	do	51 12
1	Iron barred door with frames, iron fixtures & Complete	51	0	do	51 0
1	Do do do do do do	60	"	do	60
4	Do do do do do do	47	12	do	191
1	Do do windows with glassed shutters, frames, iron fixtures & Complete	71	"	do	71
1	Do do do do do do	67	8	do	67 8
1	Do do do do do do	84	"	do	84
2	Teak wood shutters to the old windows	29	8	do	59
8	Teak wood shutters to be removed from outside to inside of the rooms	"	12	do	6
2	Teak wood weatherboards Complete	6	"	do	12
6	Repairing iron Ventilators	1	8	do	9
12	Teak wood battens to the Bart house Ventilators	"	12	do	9
1	Teak wood stair case Complete	70	"	do	70
	Wood oil to doors & windows	15	"	"	15
13	Making door ways & fixing doors	2	"	do	26
3	Blocking up the present door ways	3	"	do	9
	Dismounting the old roof of Eastland South Verandah				20
	Do do of Razin's room &c				41
	Do do Christadar & Pleaser's rooms				40
	Contingencies				4866 13
					257 8

4866 13
257 8

Total Rupees

Reduct the value of old materials

5744


1144

Balance remaining 5000

H. L. B. & Co. 17/11/92.
 Assistant Engineer 12/11/92

1. Christadar's room 12/11/92
 2. Razin's room 12/11/92
 3. Pleaser's room 12/11/92
 4. Christadar & Pleaser's rooms 12/11/92

Executive Engineer
 20th November 1886

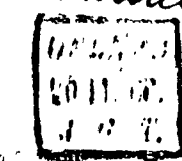

J. B. B.
 Executive Engineer
 12/11/92

P106162/66.

Abstract Estimate
for Repairing the
Court House at
Vizagapatnam -
Rs. 5000.

Encls.
2.
1. Estimate.

G.O. No. 2539
of 31st Aug. 1865.
No 152.

#207 : Supg. Engineer's Office, 1st Dec.
Camp Vizagapatnam.
18th December 1866.
From Lieut. Col. J. J. Moberly R.E.
Ag. Supg. Engineer, 1st Dec.
To Colonel C. A. Barr R.E.
Secretary to Govt., M.D.
Madras.

Sir, I have the honor to enclose an estimate for repairs amounting to reconstruction of a part of the Court house at Vizagapatnam. - the building used as such was formerly the jail, a large terraced house, with an upper story, on four sides surrounding an open quadrangle & verandah on 3 sides.

2. The roof of one side of this upper story had some time since caused so much pressure on the walls, that they were clearly thrown out of the perpendicular; to remedy this on one side, buttresses were constructed at a cost of Rs. 152 sanctioned in G.O. No. 2539 of 31st August 1865; the spreading of the roof has however continued and several of the rafters have now no footing on the wall and are carried by the purlin only. the ends are eaten by white ants in some

some degree also - so that there is no alter-
-native but to take down & reconstruct
the roof.

3. The veranda is 12 ft. wide are very
badly built; the roof Bengal pattern
has very little slope: its rafters are not
built into the wall at the upper end, but
rest on a wooden bressummer supported
by brackets from the wall - they have
not even a notch to keep them in position.
the consequence is that great pressure has
been thrown on the pillars outside, which
all show signs of weakness. the bressum-
-mers & brackets themselves too have been
in parts injured by white ants.

4. I inspected the building at Captain
Beatty's request, and have authorized
his immediately removing some parts
which are dangerous, and under which
sitters in the Court are likely to pass or
stand in numbers.

5. Captain Beatty has warned the
Judge also as to the risk from occu-
-pying the wing above mentioned, but
I have no information as to the accom-
-modation he can procure elsewhere.
If he can vacate it, I shall request
Captain

Captain Beatty to take down as much
as he can from the roof to save the ma-
-terials & to prevent its fall. but I
trust that the Government can allot
funds for the reconstruction of the build-
-ing.

I have yes yes

H. M. B. S. J. M. B. S.
Superintending Engineer

1867
Civil Works
Public Works Department
1866
Proceedings of the Madras Government
Under date the 9th January 1867.

Read the following
From
The Acting Supt Engineer
of the 1st Division (H.E. No. 207 of 11th December 1866)

In G. O. No. 2539, dated
the 31st August 1865, sanction
was accorded to an estimate
of Rs 152 for the erection of
butterflies to support the
northern walls of the Civil
Court House at Vizagapatam.
The Asst Supt Engineer of the 1st Division
now reports that, although
that work was carried out,
the roof of the building
has continued to spread,
and that it is absolutely
necessary it should be
taken down and re-con-
structed. Colonel Moberly
further represents that the

N.
W.M.

31 Aug 1865 No. 2539

P. 11/10/66 Declaration
of the 1st Division
to the Secretary to Govt
P. W. D.

Dated 11th Decr
Recd 11th Decr
Recd 19th Decr
Under No 207
Towards for sanction
are submitted for repair
of a part of the Court House
at Vizagapatam.

31 Aug 1865 No. 2539
1867
1866-97 Aug 1867

the verandahs are in a dangerous state, and he submits an estimate amounting to Rupees 5,000 for such improvements as are actually required to place the building in a safe condition. The Government approve of the estimate and they resolve to place a sum of 2000 rupees at the Capt Engineer's disposal from the Reserve under "Civil Buildings".

To admit of the work being at once proceeded with. Should a further grant be necessary during the current financial year it will not with Board authority be proposed a diversion of funds from existing Reserve sanctions for works in the 1st Division —

W. J.

6 To The Deputy Commr ✓
4 - Controller of Stores ✓
3 - Accountant General ✓
11 Judicial Dept ✓

Desks 10:30 January 187

102

J. H. 1864 Dep't
Pro: of Govt for Laury

Ap 16.

Pro: of the Madras Govt

27th January 1864

An estimate of
Rupees 5000 for improve-
ments to Court-house at
Vizagapatam, sanctioned
and Rs 2000 placed at the
Supt. Engrs disposal for the
immediate commencement
of the work.

Ap 139. 140

23rd Jan. 1864 Dr. Jm